

International Journal of Civil Engineering and Geo-Environmental

Journal homepage: <http://ijceg.ump.edu.my>
ISSN:21802742

Collapse Analysis of Car Porch Steel Structure due Wind Storm

T.A. Majid¹ S.S. Zaini¹ and Noram I. Ramli^{2*}

¹Disaster Research Nexus, School of Civil Engineering, Universiti Sains Malaysia, Penang, Malaysia

²Faculty of Civil Engineering and Earth Resources, Universiti Malaysia Pahang, Malaysia

ARTICLE INFO

Keywords:

Wind Storm, Roof Steel Frame, Non-Engineered Structure

ABSTRACT

Malaysia is a country with tropical climate. During the monsoon season, heavy rains and thunderstorm affect many places, especially at the east coast of Peninsular Malaysia and East Malaysia. Strong wind that produced significant wind force has proven to cause damage especially to low-rise non-engineered structures. Currently, numerous evidences of damages and loss caused by thunderstorm can be obtained. In 30st July 2009, a car porch steel frame in Taman Murni, Parit Buntar, Perak, was badly damaged during a heavy down fall and strong wind. An investigation had been carried out. From the result it show that the actual steel frame at the site was tremendously under designed which reflect the non-involvement of structural engineers.

1. Introduction

Unlike in cyclone prone region, the thunderstorms in Malaysia occurs in micro scale (Yusoff , 2005). Despite their small size and short duration of thunderstorm which is about 15 to 30 minutes, thunderstorms are still capable of producing hail, heavy rain, frequent lightning and strong gusty wind (Holmes, 2001). An incident occurred at Taman Murni, Parit Buntar where a car porch steel frame was damaged during a particular thunderstorm. It was observed that several trusses deflect excessively as well of dislocation of bolts from their joints. It was strongly believed that the steel frame was constructed without proper engineering considerations such as loading and factor of safety. In the case of low-rise engineered structures, failure due to strong wind always associated to poor workmanship, inferior materials or underestimation of the wind speed. (Stathopoulos, 1984) This issue can be reduced effectively if proper design work is carried out in the first place without ignoring the

economical aspect. An investigation of collapse car porch has been carried out, appropriate in-situ and laboratory tests as well as modeling and analyzing a car porch steel frame which was previously damaged during a thunderstorm event. The analysis is carried out under linear elastic condition with the aid of STAAD Pro 2007. Steel grade for all structural members is taken as steel grade S275 according to BS 5950:2000.

Calculation of wind pressure is based on the rules set by MS 1553: 2002, Code of practice on wind loading for building structure. Only unfactored load comprising of member self weight, wind load and hydrostatic pressure due to rain are used in the analysis.

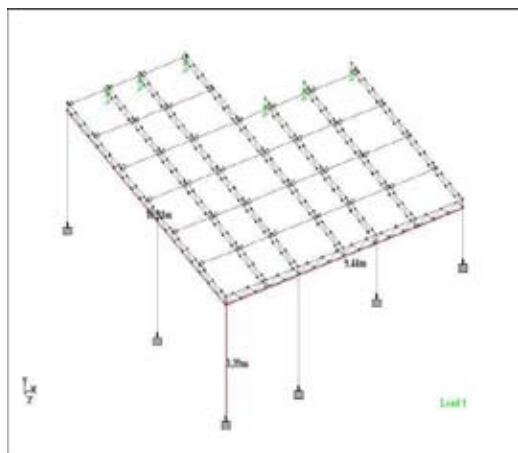


Figure 1. Car Porch Analyses using STAAD Pro 2007

Table 1: Actual STAAD Pro 2007 output vs. estimated secondary truss support capacity

| Wind pressure (kN/m ²) | STAAD support reaction (kN) | Truss support capacity (kN) | Condition |
|------------------------------------|-----------------------------|-----------------------------|-----------|
| 0.200 | 1.584 | 3.475 | Pass |
| 0.290 | 2.359 | 3.475 | Pass |
| 0.300 | 2.430 | 3.475 | Pass |
| 0.400 | 3.145 | 3.475 | Pass |
| 0.430 | 3.360 | 3.475 | Pass |
| 0.440 | 3.431 | 3.475 | Pass |
| 0.445 | 3.467 | 3.475 | Pass |
| 0.450 | 3.503 | 3.475 | Fail |
| 0.500 | 3.860 | 3.475 | Fail |
| 0.600 | 4.770 | 3.475 | Fail |

Table 2: Comparison between actual STAAD Pro 2007 output and estimated base support capacity

| Wind pressure (kN/m ²) | STAAD support reaction (kN) | Truss support capacity (kN) | Condition |
|------------------------------------|-----------------------------|-----------------------------|-----------|
| 0.200 | 2.386 | 5.688 | Pass |
| 0.290 | 3.423 | 5.688 | Pass |
| 0.300 | 3.516 | 5.688 | Pass |
| 0.400 | 4.450 | 5.688 | Pass |
| 0.430 | 4.729 | 5.688 | Pass |
| 0.440 | 4.873 | 5.688 | Pass |
| 0.445 | 4.869 | 5.688 | Pass |
| 0.450 | 4.916 | 5.688 | Pass |
| 0.500 | 5.383 | 5.688 | Pass |
| 0.600 | 6.319 | 5.688 | Fail |

Table 3: Comparison between STAAD Pro 2007 output (tensile stress for member 774) and theoretical fillet weld capacity

| Wind pressure (kN/m ²) | Tensile stress (N/mm ²) | Theoretical weld capacity (N/mm ²) | Condition |
|------------------------------------|-------------------------------------|--|-----------|
| 0.200 | 99 | 220 | Pass |
| 0.290 | 140 | 220 | Pass |
| 0.300 | 145 | 220 | Pass |
| 0.400 | 194 | 220 | Pass |
| 0.430 | 208 | 220 | Pass |
| 0.440 | 214 | 220 | Pass |
| 0.445 | 216 | 220 | Pass |
| 0.450 | 214 | 220 | Pass |
| 0.500 | 223 | 220 | Fail |
| 0.600 | 282 | 220 | Fail |

2. Roof failure of the car porch steel truss

The root failure of the steel frame is determined when any of the possible failure triggered due to a particular value of wind force. The threshold limit for truss support capacity, base support capacity and fillet weld capacity are set at the first place. The actual truss support system consist two bolts with 3.5 mm diameter. These bolts are off inferior quality and each bolt only posses shear strength of 1.3735 kN, associated to shear strength capacity of 143 N/mm². This value is low compared to bolt grade 4.6 where the minimum shear strength is 180 N/mm² as stated in Table 30 BS 5950-1: 2000. The bolt was installed by post-drilled technique to the wall and fascia board in simple connection. Obviously, in simple connection only shear force will be experienced by the bolts. As such, simple connection requires bolts with high shear capacity.

By inspecting the theoretical load path, failure to secondary truss support system resemble a cantilever with all loads resisted only at one end. The magnitude of load at the resisted end (in this case, the resisted end being supported by main truss) increase tremendously and resulting an increase in tension to chord members. As chord members are connected by fillet weld, tensile stress in the chord members that exceeded the welding capacity of 220 N/mm² had caused failure to the chord member. In this case, member 774 failed due to this reason.

3. Estimation of wind speed

In this study, the wind force triggering the initial failure was back calculated in order to obtain wind speed, following the steps set by MS 1553. The results show that the minimum wind force triggering the first failure is 0.45 kN/m^2 reflecting a wind speed of 37.796 m/s . This value is above the maximum basic wind speed of 32.5 m/s for Zone 2 or 33.5 m/s for Zone 1 as stated in MS 1553. Since this location is situated at northern region of peninsular Malaysia which is bordering to the Thailand Country in Zone 4a and Zone 4b. The Thailand code where referred. In Thailand code the basic wind speed for the southern region which is classifies as zone 4a is 25 m/s base one-hour average speed at 10 m . (Boonyapinyo, 2009) If this wind speed converted to 3 second gust it will be equal to 37.5 m/s (Majid et. al, 2010).

However, the basic wind speeds stated in MS 1553:2002 are derived statistically based on mean 3.0 second gust. Although this value is safe to be adopted in designing structures less than 200 meter, this study found out that the actual wind speed increased during a particular thunderstorm event or experiencing high turbulence intensities as stated earlier in the case of low rise building that usually immersed within the layer of aerodynamic roughness. Unfortunately these effects are difficult to quantify.

Under Beaufort Scale, wind speed of 37.796 m/s is classified as hurricane where the effect can cause damaged to poorly constructed sheds (Meaden et. al., 2007). Although in Malaysia the term 'hurricane' is not technically used, the effect agrees with the damage observed at Taman Murni as well as in many states in Malaysia. Under Fujita Scale, wind speed 37.796 m/s or 136 km/h is classified as F1 scale resulted in moderate damage which include damage to attached garages (Doswell et. al, 2009) . Again, the effect agrees with the local damage.

4. Conclusion

From the investigation, the initial members that form the car porch steel frame were found to be under sizes leading to inadequacy in design under ultimate limit state. The structural

arrangement was improper where basic engineering knowledge in terms of the load path, obviously was not applied.

References

- Boonyapinyo V. , Wind Loading Standard for Building Design in Thailand and Country Report 2009, APEC WW, Taipei 2009
- BS 5950: Part 1: 2000 "Structural Use of Steelwork in Building – Part 1: Code of Practice for Design – Rolled and Welded Sections"
- BS 6399: Part 1: 1996 "Loading for Buildings – Part 1. Code of Practice for Dead and Imposed Loads"
- BS 8110: Part 1: 1997 " Structural Use of Concrete – Part 1. Code of Practice for Design and Construction"
- Doswell. C. A., Harold E. Brooks, Nikolai Dotzek, "On the implementation of the enhanced Fujita scale in the USA" Atmospheric Research 93 (2009) pp. 554–563
- Holmes J. D. (2001). "Wind Loading of Structures". Spon Press, Taylor & Francis Group, New York
- Majid T.A., Noram I. Ramli , M. I. Ali ,M. Syamsyul H. Saad M. Hashim I. Zakaria' Malaysia country Report (a) – Wind Load for Building Structure in Malaysia – 6th Workshop on Regional Harmonization of wind loading and Wind Environment Specification in Asia Pacific Economies (APEC-WW2010) Kwandong University, South Korea
- Meaden G. T., S. Kochev, L. Kolendowicz, A. Kosa-Kiss, Izolda Marcinoniene, Michalis Sioutas, Heino Tooming, John Tyrrell "Comparing the theoretical versions of the Beaufort scale, the T-Scale and the Fujita scale" Atmospheric Research 83 (2007) pp. 446–449
- MS1553:2002 "Malaysia Standard Code of Practise on Wind Loading for Building", Department of Standards Malaysia

- Stathopoulos T. (1984). "Wind Loads on Low Rise Buildings: A Review of the State of the Art, Engineering Structures 6, pp. 119-135
- Yusoff A. (2005), "A study on the characteristics of thunderstorm at Telekom Malaysia communication center, Seberang Jaya, Penang", MSc Dissertation, School of Civil Engineering, Universiti Sains Malaysia

GUIDELINES FOR AUTHORS

Publication Policies

Articles submitted (literature, definitive articles on methodology and procedures, quantitative and qualitative approaches to theory and empirical articles reporting original research) will be reviewed and accepted on the understanding that they have not been published elsewhere.

Submission Information

Authors should send an electronic version of their article by e-mail to the Editor-In-Chief at ijceg@ump.edu.my. Pages should be numbered consecutively.

Submission of Papers

Submission of an article is understood to imply that the article is original and unpublished and is not being considered for publication elsewhere. Once accepted for publication, the publisher assumes that copyright has been transferred over by the authors. All manuscript will be judged by at least three (3) referees to ensure material originality, accuracy and relevance.

Manuscript Preparation

Technical Requirements for Paper

The length of articles should be between 3,000 and 5,000 words or approximately **5-15 printed pages**. The articles should be written in MSWord and in proper English.

Types of Fonts

All texts, drawing, graph must be written using **Times New Roman, 10 point**

Spacing

Single

Language

Follow the spelling of the Oxford English Dictionary.

Paper Title

The title of the paper should be concise and indicate clearly the nature of the contribution. **14 point, left justified** as shown below.

Bending Behavior of Semi-Continuous Prefabricated Profiled Steel Sheeting (PSSDB) Floor Panels

Authors

The author's name and affiliation should follow below the title. **12 point, left justified** as shown below.

Norhaiza Nordin^{1*}, Wan Hamidon Wan Badaruzzaman², Nasly Mohd Ali¹, Wan Mansor Wan Muhamad³, Khairunnisa Muthusamy¹

Affiliation

Position and full addresses (including post codes). Use numbers to indicate affiliations, **8 point, left justified**.

¹ *Faculty of Civil Engineering & Earth Resources, Universiti Malaysia Pahang, Pahang, Malaysia.*

Abstract

An abstract not exceeding 250 words outlining the purpose, scope and conclusions of the paper, **9 point, fully justified**. It should be a **single paragraph**.

Keywords

Maximum of five (5) selected keywords should be provided, **9 point, left justified**.

Style

Manuscripts should consist of the following sections: Introduction, Methods/ Theory, Results and Discussions and Conclusions.

Body Text

All paragraph must be differentiate by a **single spacing, justified**.

Symbols & Units

Papers containing a substantial number of equations must have a list of symbols with units. Express all quantities in SI units, with other units in parenthesis if desired. Use *Italics* for symbols where appropriate.

Tables

Table should be **incorporated in the text, 10 point** and numbered consecutively with Arabic numerals. Each table should have a descriptive title / caption and should be written above the table, **10 point, table line 0.5 point**.

Illustrations

Illustrations (figures, photos and graphs) should be incorporated in the text and put in box with line width 0.5 point. Illustrations should be numbers consecutively throughout the paper by Arabic numerals (**Figure 1, Figure 1 - 5**). Caption should be written below the figures, **10 point**. Make sure lettering on drawings is proportional to the figure, professionally quality, large enough and suitable for appropriate reduction for publication if necessary. Figures should be submitted with high contrast in black and white unless colour is required. Do not use a grey background in line drawings. Figures should be about twice the desired size for printing and suitable for reproduction.

References

References should appear in a separate reference sheet at the end of manuscript, **10 point**. References should be cited in the text as follows: “Wright and Paquette (1987) found...” or “(Roberts et al.1991)”. References should be listed in alphabetical order. In the list of references, the title of periodicals should be given in full, while for books should state the title, place of publication, name of publisher and indication of edition. Unpublished material or personal communications may be mentioned in text, but should not be included in the reference list.

Books:

Patrick Lavin.(2003) A Practical Guide to Design, Production and Maintenance for Engineers and Architects. London: Spoon Press, 125 pp.

Chapter in Book:

Johan, R. (1999). Fire Management Plan for the Peat Swamp Forest Reserve of North Selangor and Pahang. In Chin T.Y. and Haymoller, P. (eds) *Sustainable Management of Peat Swamp Forests in Peninsular Malaysia* Vol II: Impacts. Kuala Lumpur: Forestry Department Malaysia, 81-147.

Journal:

Mead, S.P. (1997). Project-specific intranets for construction teams. *Project Management Journal*, 28(3):44-51.

Thesis:

Portela, A. (1992) *Dual Boundary Element Increment Analysis of Crack Growth*. Ph.D Thesis, Wessex Institute of Technology, Southampton, 156 pp.

Proceedings:

Diah, A.B.M and Nuruddin M.F (1998) Concrete: Why Curing So Important for Engineers and Architects to Produce Durable Concrete Structures. *Proceedings of 16th Conference of ASEAN Federation of Engineering Organization*. Pampanga, Philippines, 51-60.

Article from Website:

Chan J.K., Tam, C.M., Chung, R.K (2005). Engineering, Construction and Architectural Management [online]. 12(2). Available from: [fulltext/document109.pdf](#) [Accessed 20 February 2005].

Footnotes

The use of footnotes should be avoided wherever possible.

Further Information

For further information on journals published by Universiti Malaysia Pahang, please visit our website at <http://ijceg.ump.edu.my> or email to ijce@ump.edu.my.